





Non- Secure Monitor 80 NS 7 78 Fig. 2 Mode NSMale 1 S Mole! NsMode 2 SMode 2


. ::

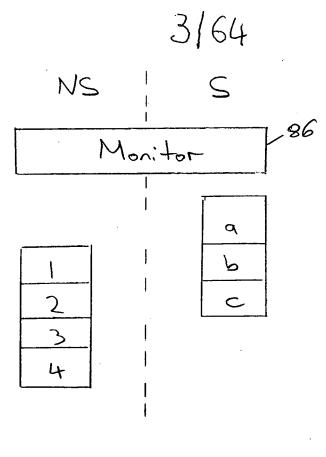




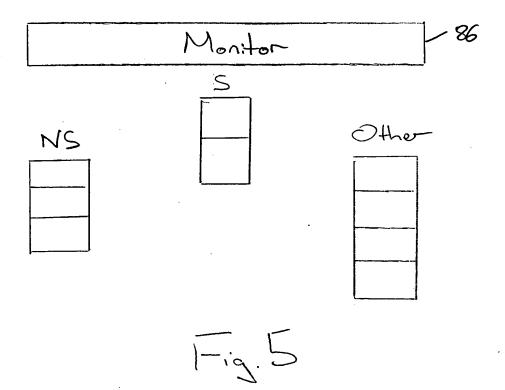

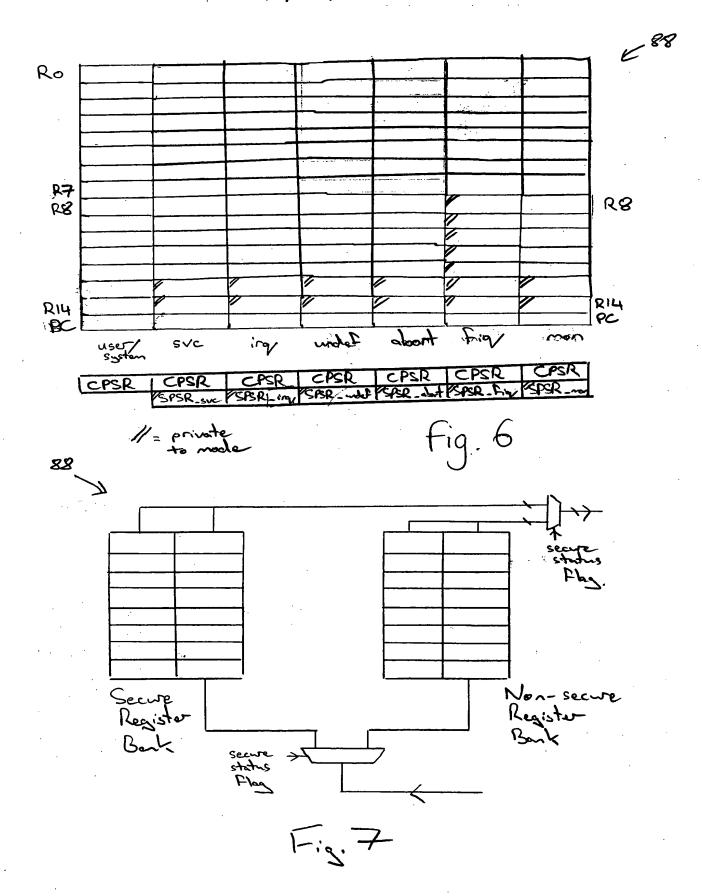

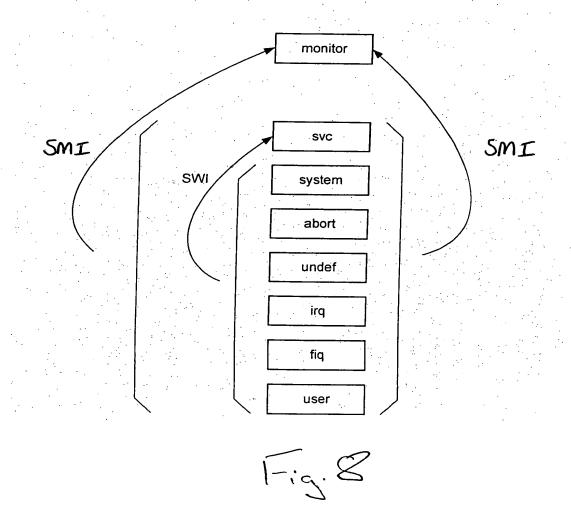

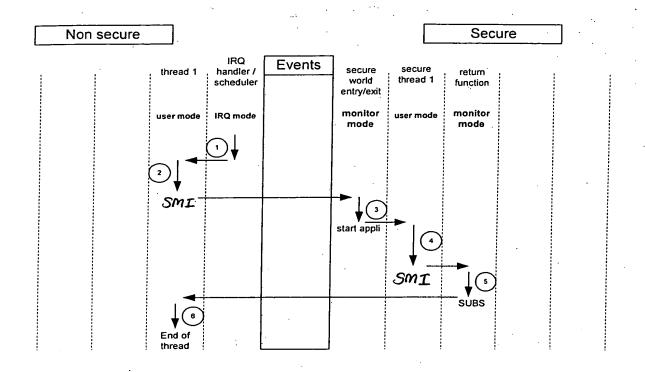

F.3. 9

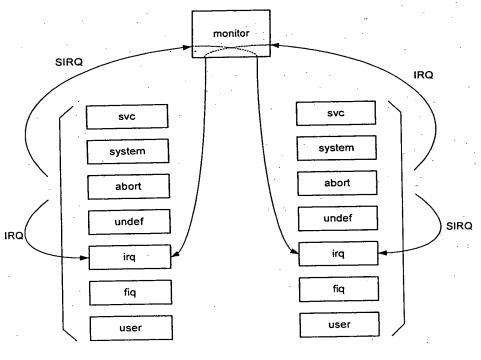
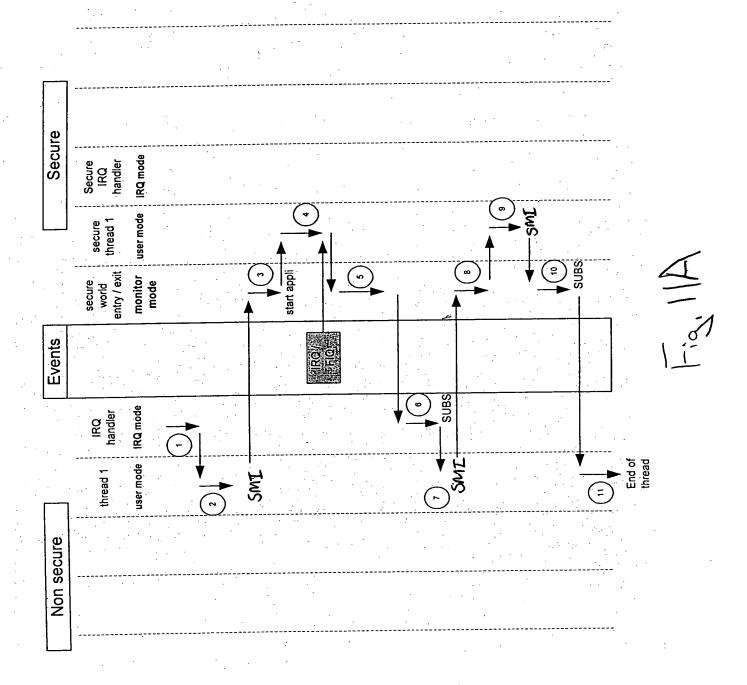
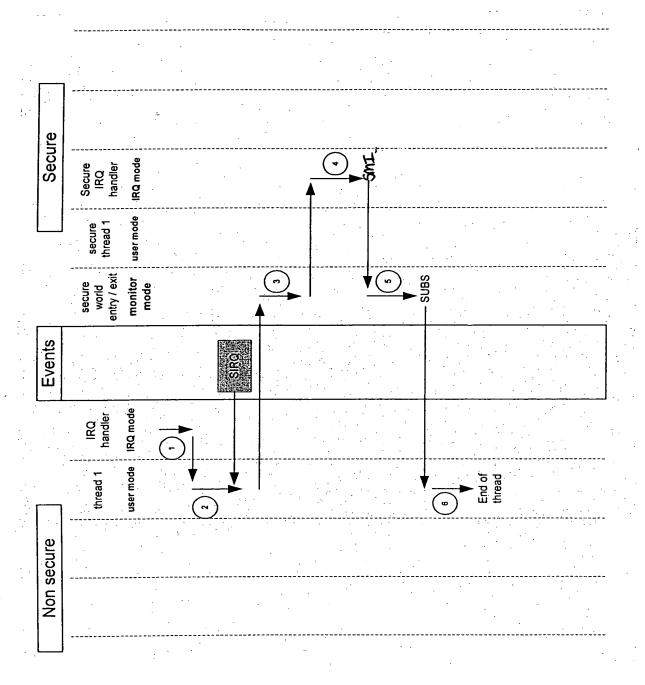


Fig. 10





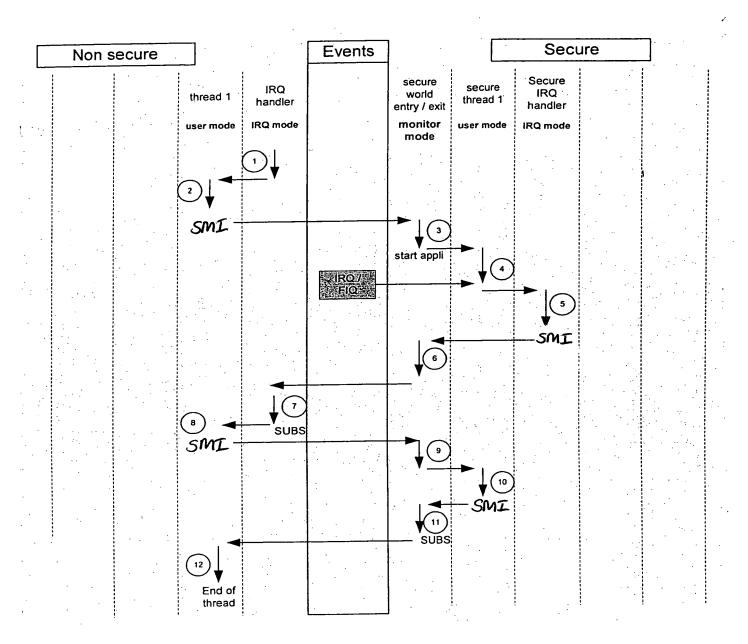


Fig. 13A

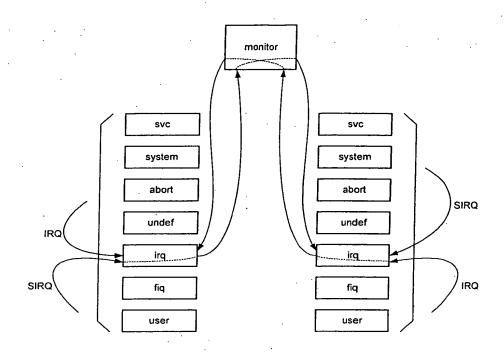


Fig. 12

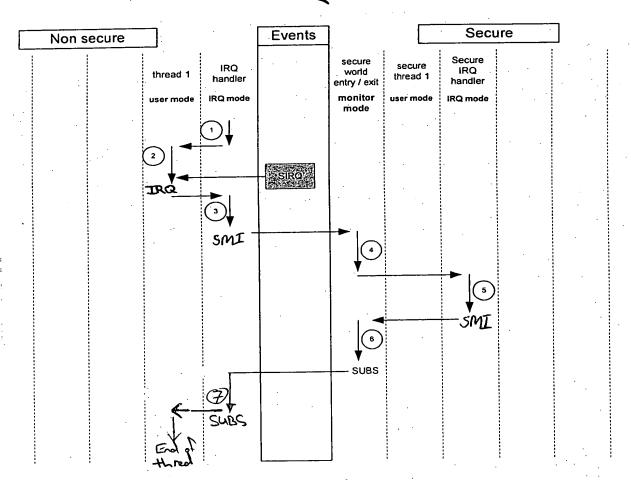


Fig. 13B

	Exception Visit 18	# - s- Vector offsels	Corresponding mode
	Reset	0x00	Supervisor mode
	Linder	0x04	Monitor mode / Unlib make
:	SWI	0x08	Supervisor mode Monter make
•	Prefetch abort	0x0C	Abort mode M . for mode
	Data abort	0x10	Abort mode / Mon: for made
	IRQ/SIRQ	0x18	IRQ mode Monitor made
	FIQ	0x1C	FIQ mode Monitor mode
1	SMI	OX 20	Mudet maje / Duta maje

F13.14

Monitor

Hasel VMO
Wholes VMI
SWI VM2
Probatch about VM3
Data about VM4
IRR/SIRR VMS
FIR VM6
SMI VM7

Non-Secure

Reset	VSØ
thous	VSI
SWI	VS2.
ProJetch abort	V S3
Data abort	VS4
IRQ/SIRQ	5
FIQ	V56
SMI	VS7

Reiset	VNSO
Topoly	VNSI
SWI	VNS2
Protetely about	NN23
Data about	VNS4
IRQ/SIRQ	VNSS
FIQ	** VNS6
SMI	VNS7

Fig. 15.

CP15 Monitor Trap Mask Register

world exception


0	1	, \	. \	. 1	0	1
SMI	SWI	Protetch Abort	Oata Abort	IRQ	PING	FIQ


*


1= Mon(S)

O = NS

OR via hardware/external

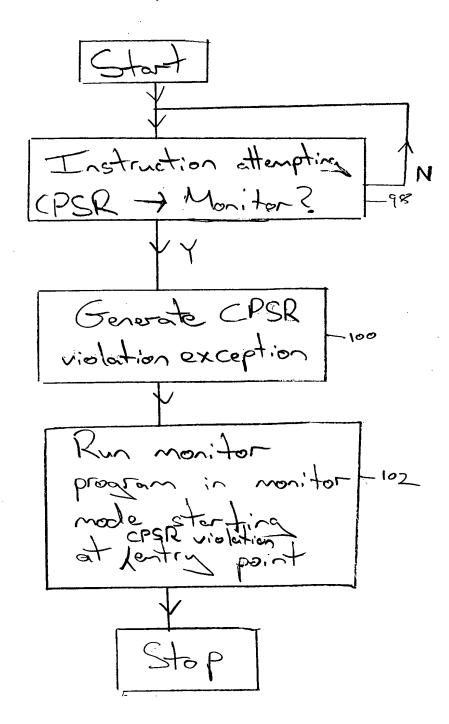

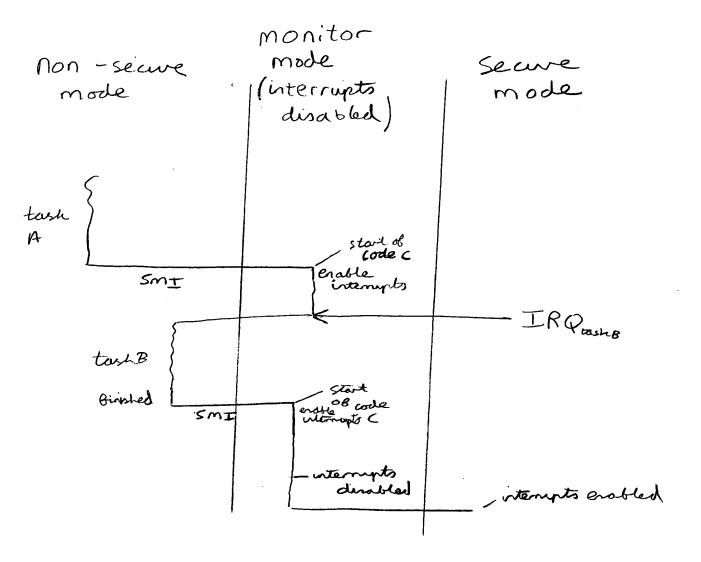

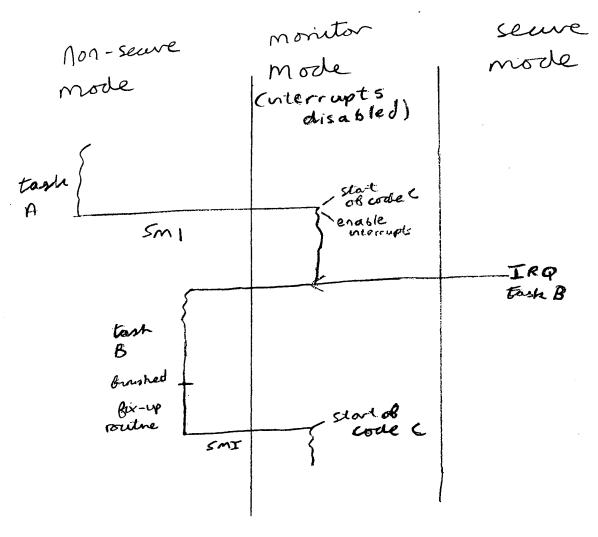

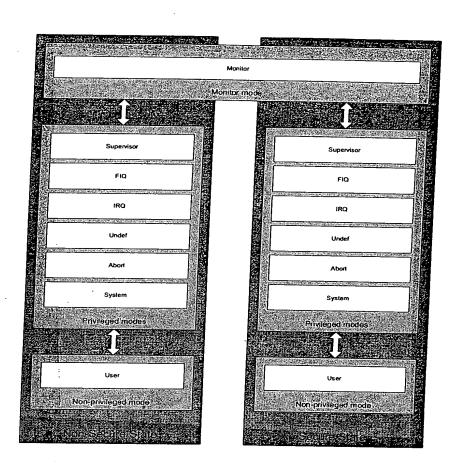


FIGURE 21

User	System	Supervisor	Abort	Undefined	Interrupt	Fast Interrupt
R0	R0	R0	R0	R0	R0	R0
R1	R1	R1	R1	R1	R1	R1
R2	R2	R2	R2	R2	R2	R2
R3	. R3	R3	R3	R3	R3	R3
R4	R4	R4	R4	R4	R4	R4
R5	R5	R5	R5	R5	R5	R5
R6	R6	R6	R6	R6	R6	R6
R7	R7	R7	R7	R7	R7	R7
R8	R8	R8	R8	R8	R8	R8_fiq
R9	R9	R9	R9	R9	R9	R9_fiq
R10	R10	R10	R10	R10	R10	R10_fiq
R11	R11	R11	R11	R11	R11	R11_fiq
R12	R12	R12	R12	R12	R12	R12_fiq
R13	R13	R13_BYC	R43_abl	R13_und	R13_irq	R13_fiq
R14	R14	14_sve	RM_sbt/	R14_und	R14_irq	R14_fiq
PC	PC	PC	PC	PC	PC	PC

Monitor	
	_
R0	
R1	
R2	
R3	
R4	
R5	
R6	
R7	
R8	
R9	
R10	
R11	
R12	
R13_mon	1
R14_mon	1
PC	Ì

CPSR	CPSR	CPSR	CPSR	CPSR	CPSR	CPSR
		SPSR_svc	SPSR_abt	SPSR_und	SPSR_irq	SPSR_fiq

CPSR SPSR_mon

FIGURE 22

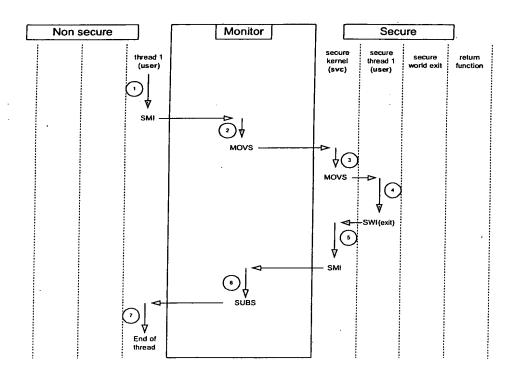


FIGURE 23

Fraditional Secure


ARM + processing

non/secure

ARM

5=1

1-13. 24

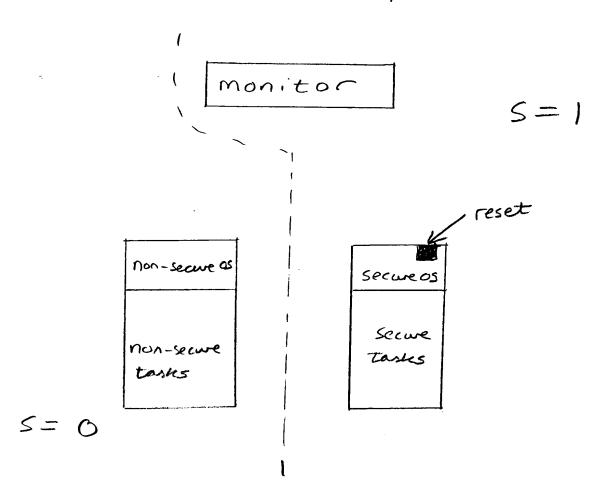

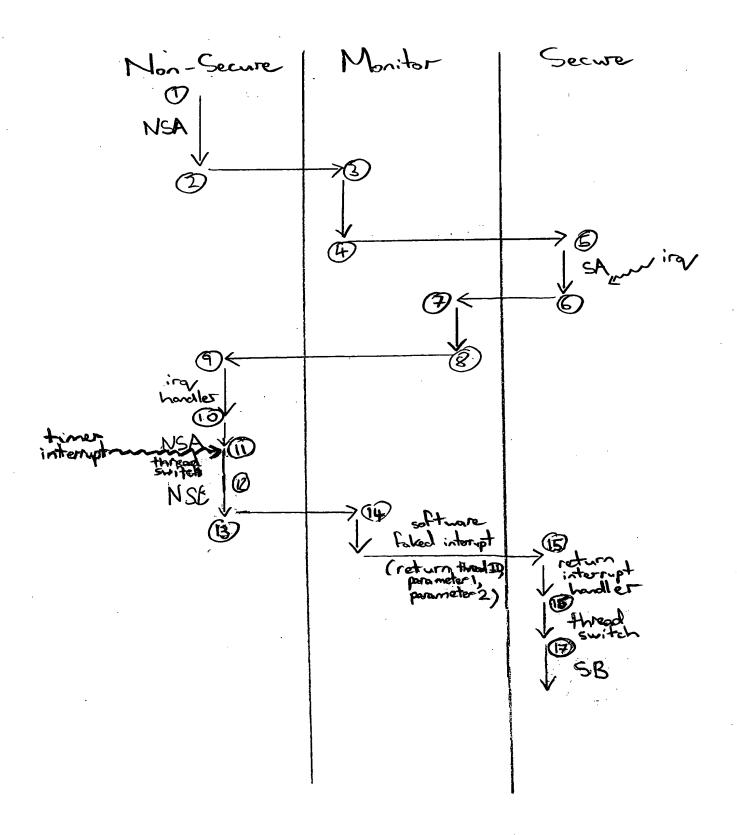
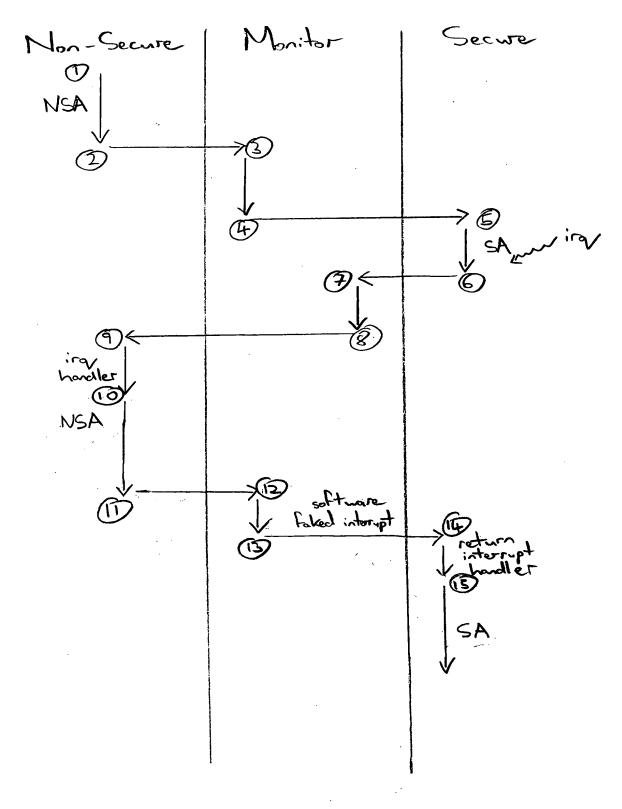
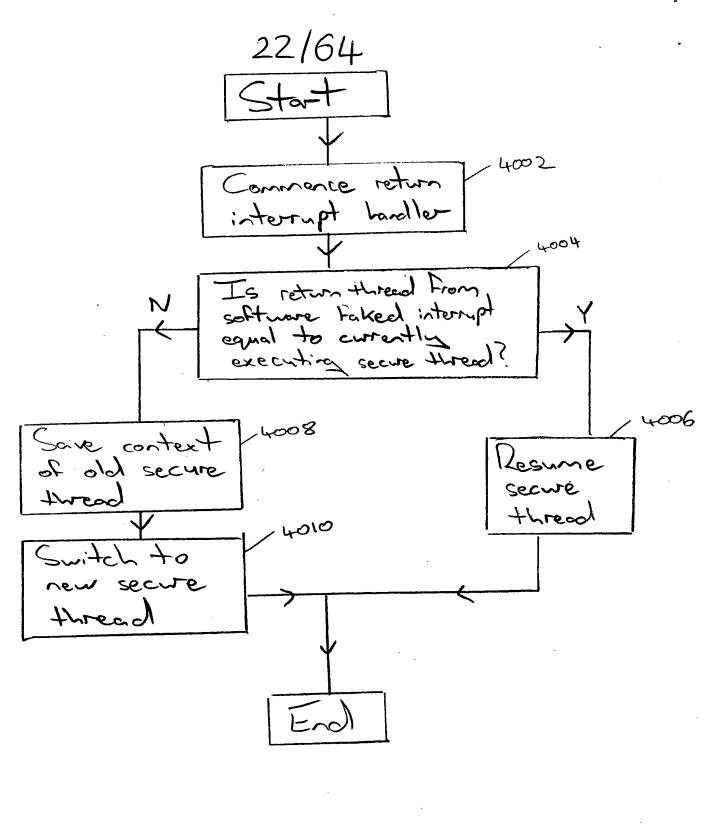
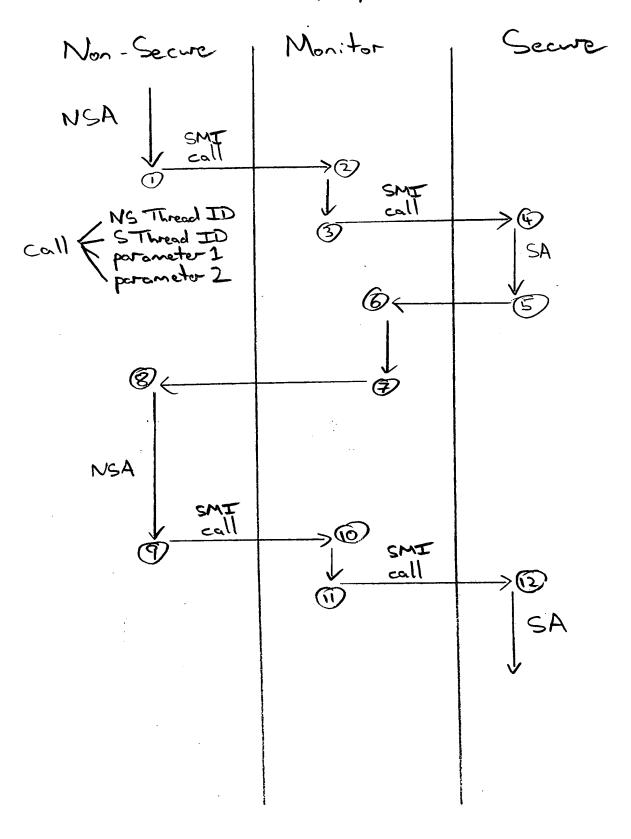


fig. 26







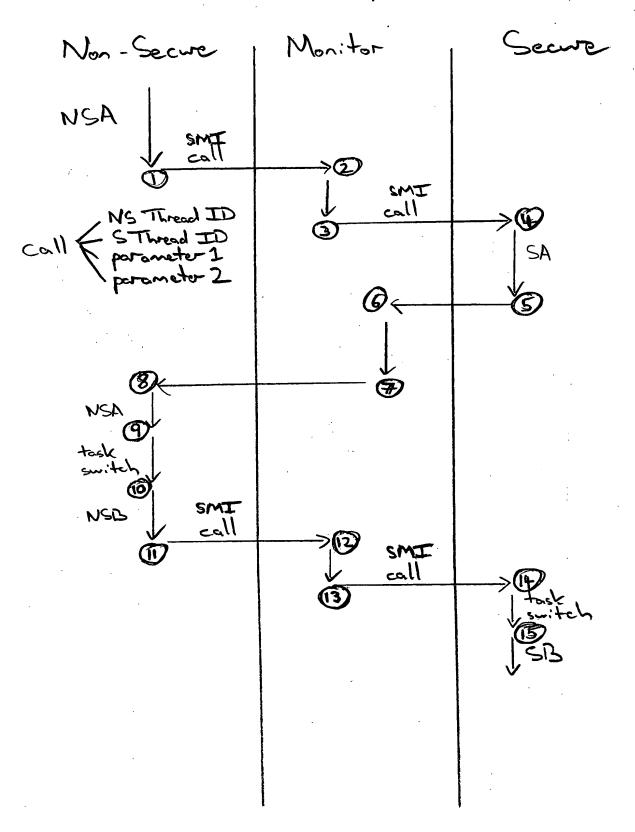


Fig. 30

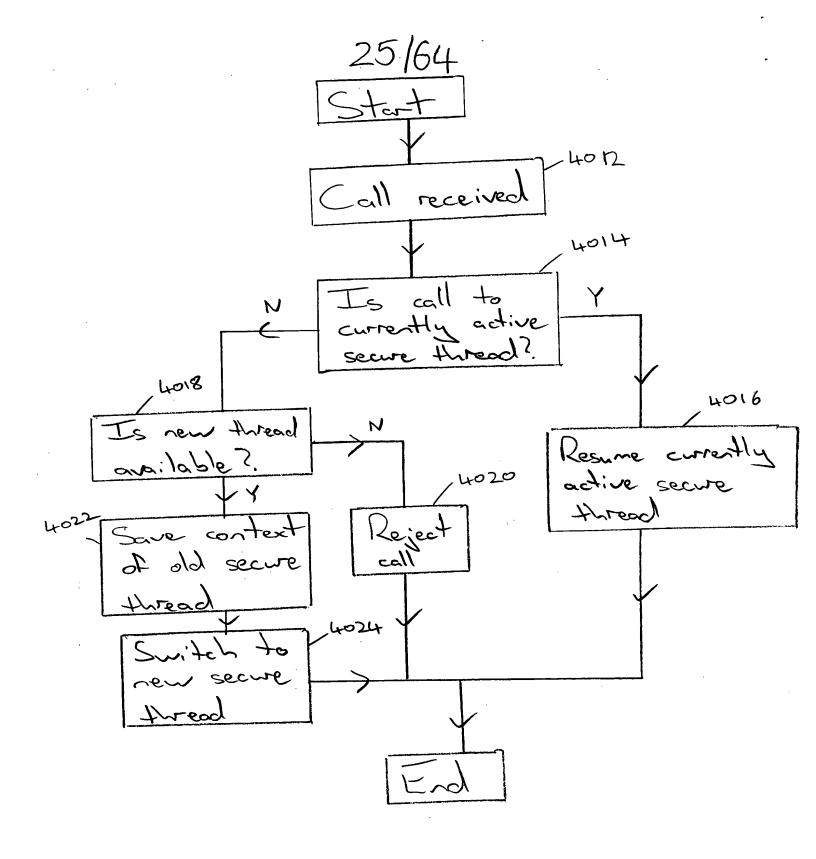



Fig. 31

26/64 Secure Monitor Non-Secure Int 2 hardler NSB


Lig. 32

Monitor Non-secure hardler Close Stub Int1 handler

Fig 33

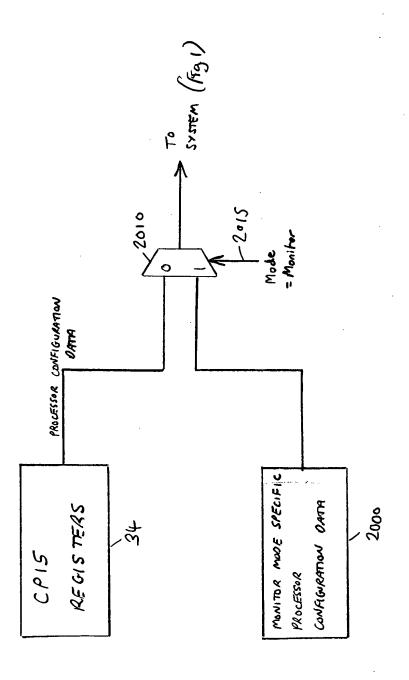

F16.35

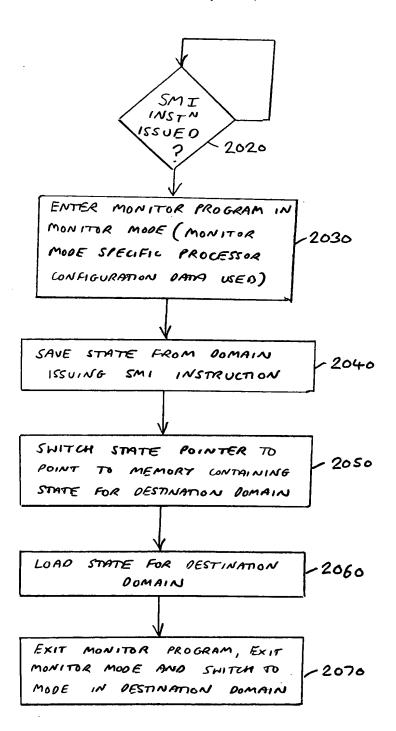

F16.36

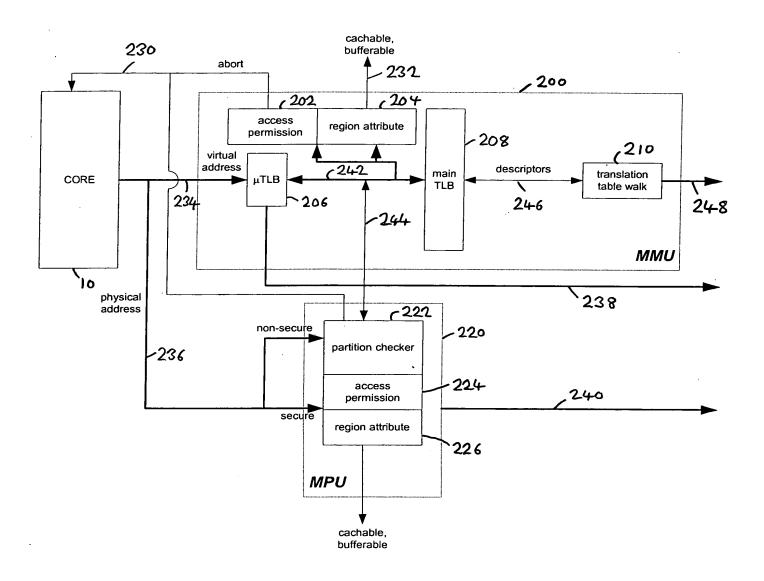


FIG. 37




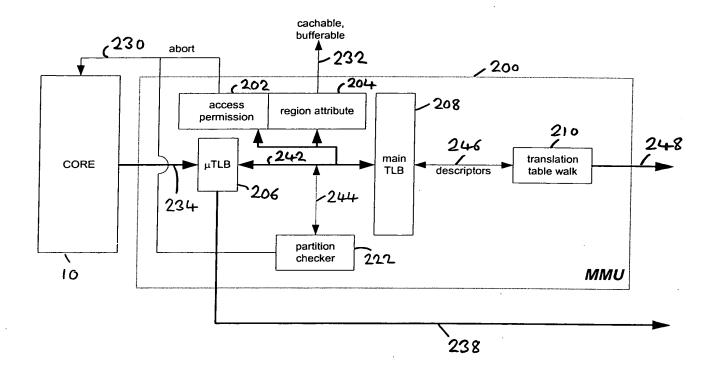


FIG. 38

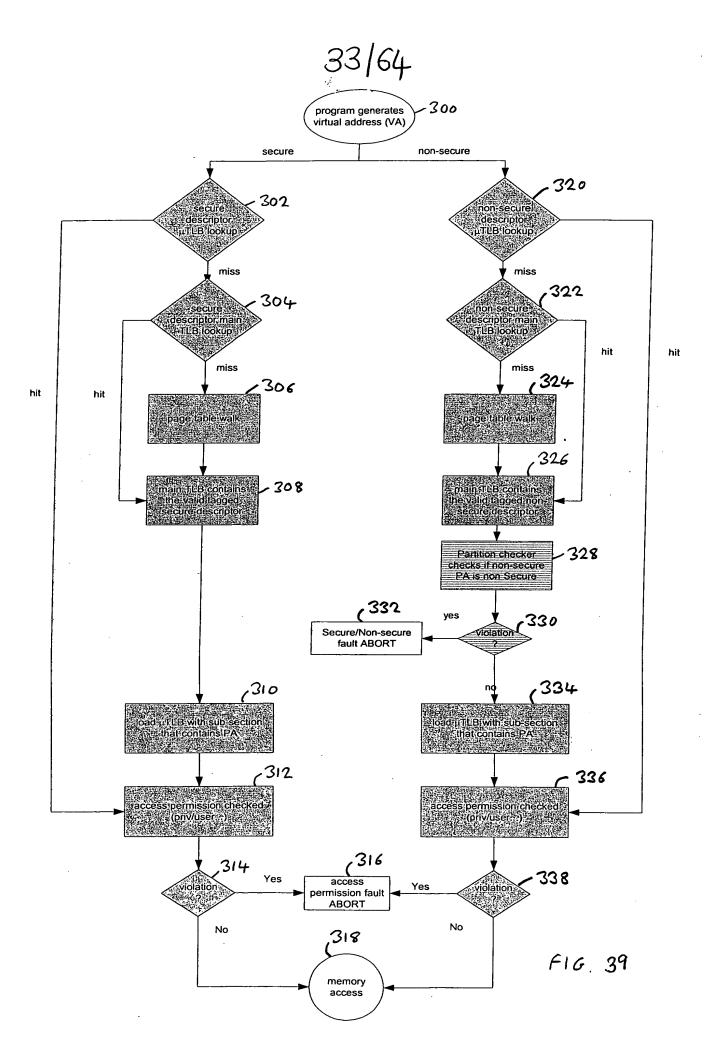


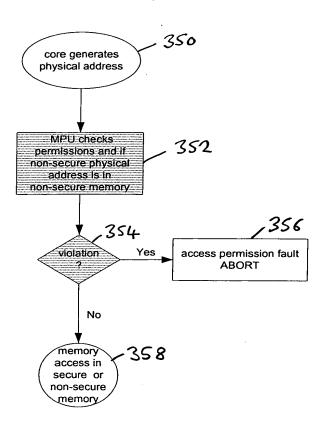


F16.40

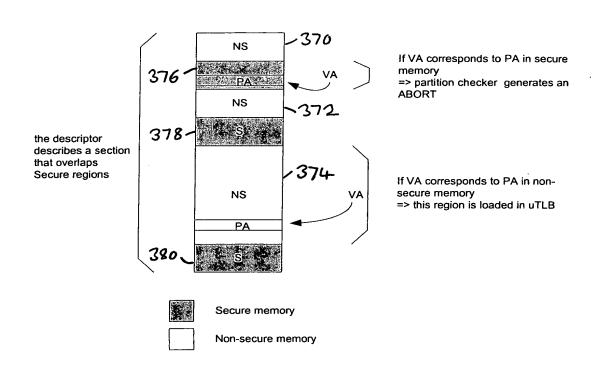

F16-41

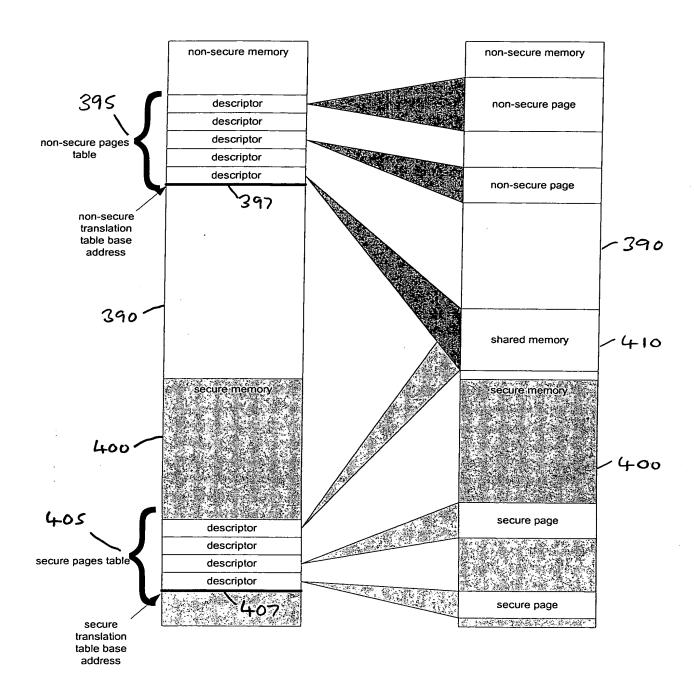

F16. 42

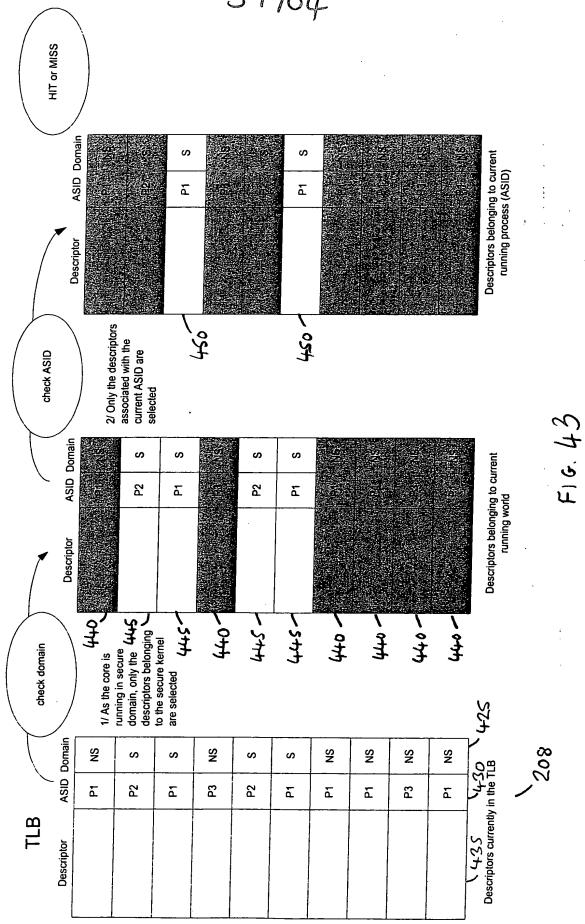

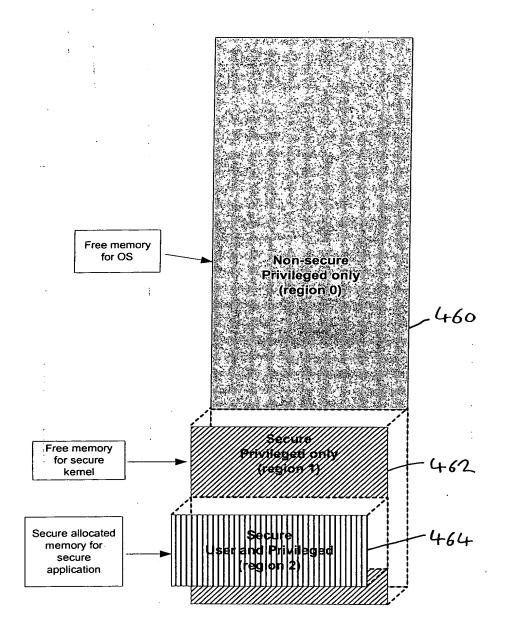


FIG. 44



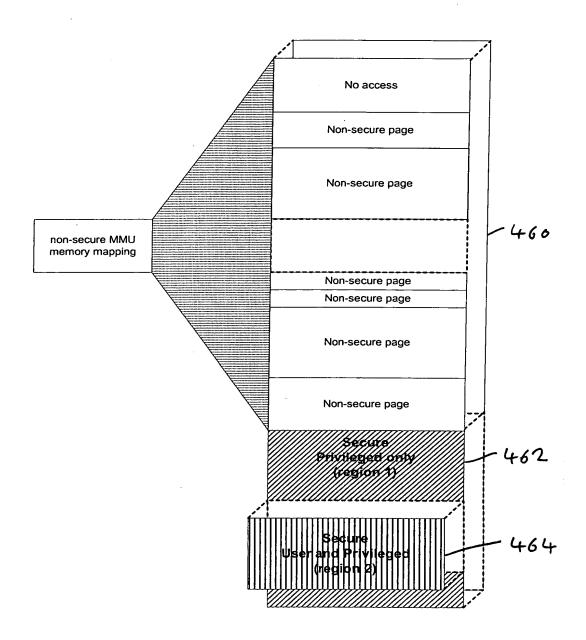


FIG. 45

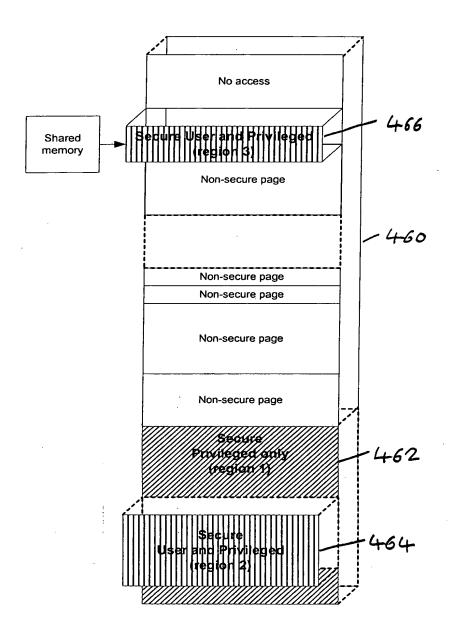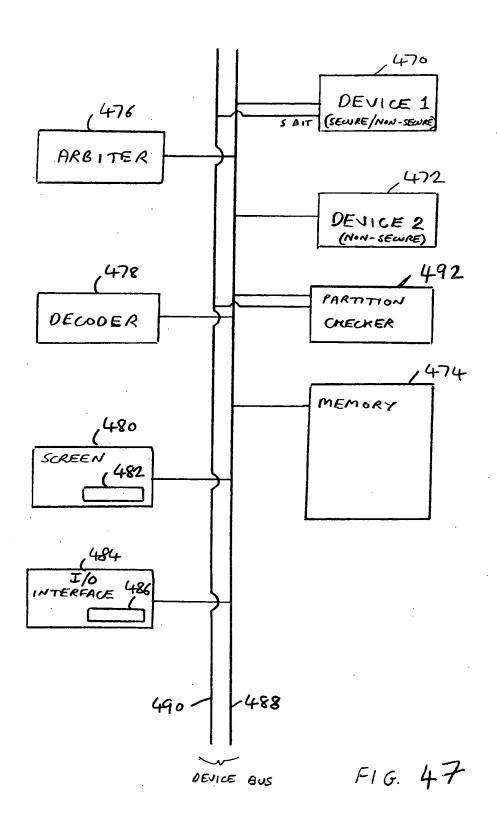

F16.46





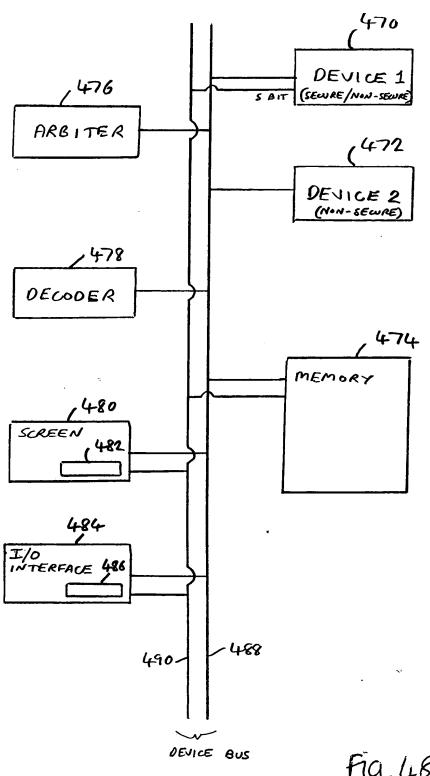


Fig. 48

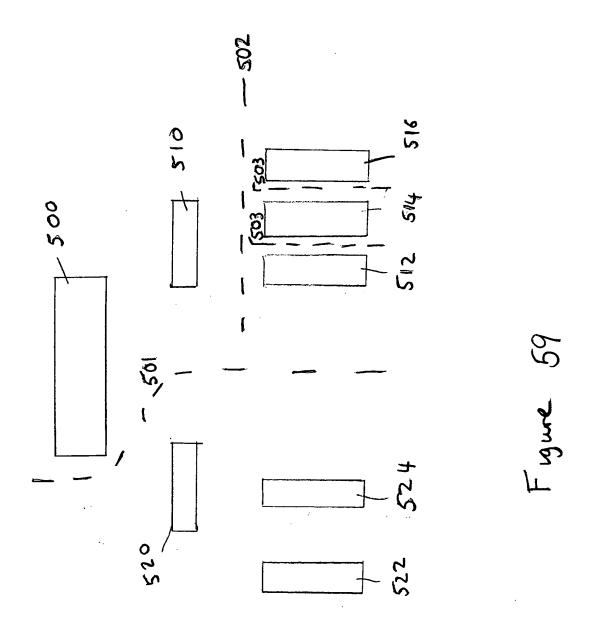

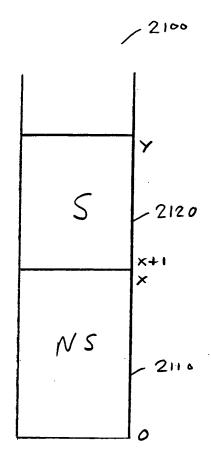

PUYSICAL BOOKESS SPACE

F16. 49


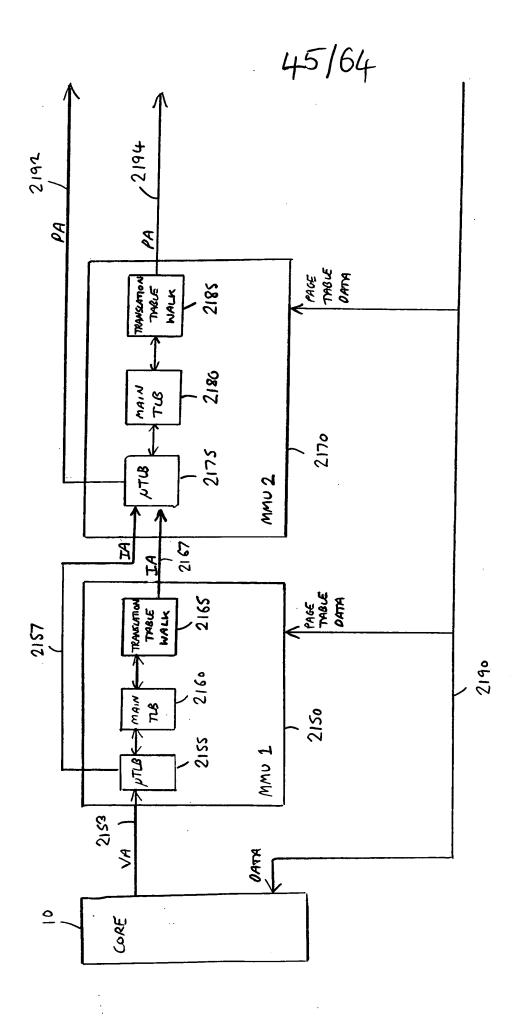


FIG SOA

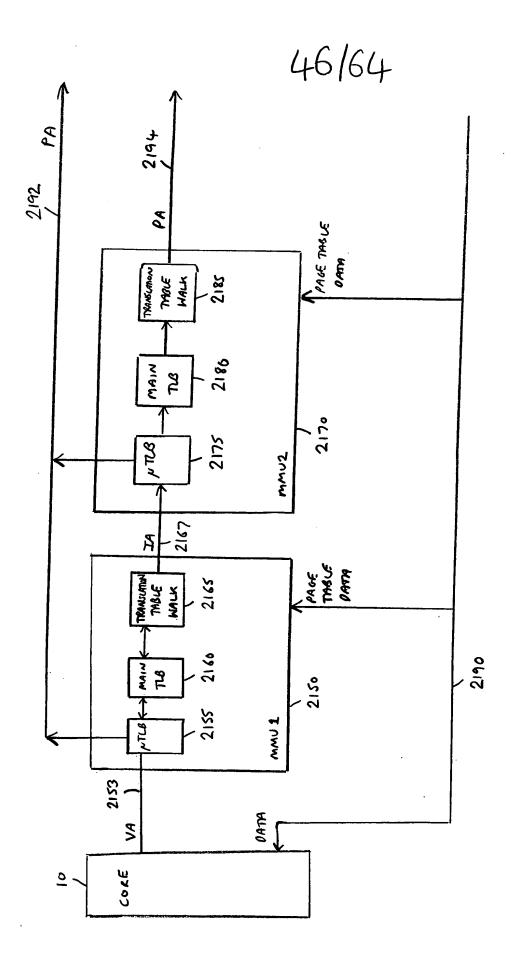

F16 50B

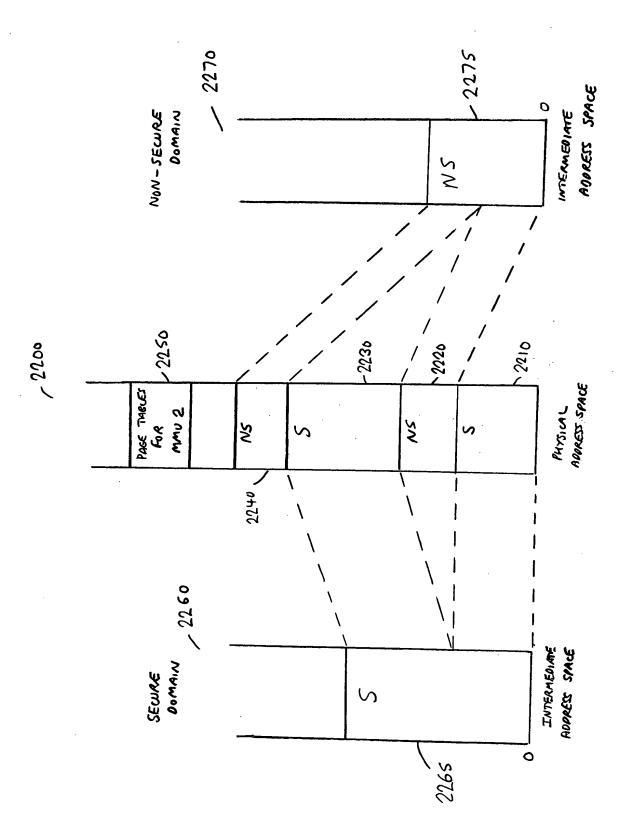


FIG 51

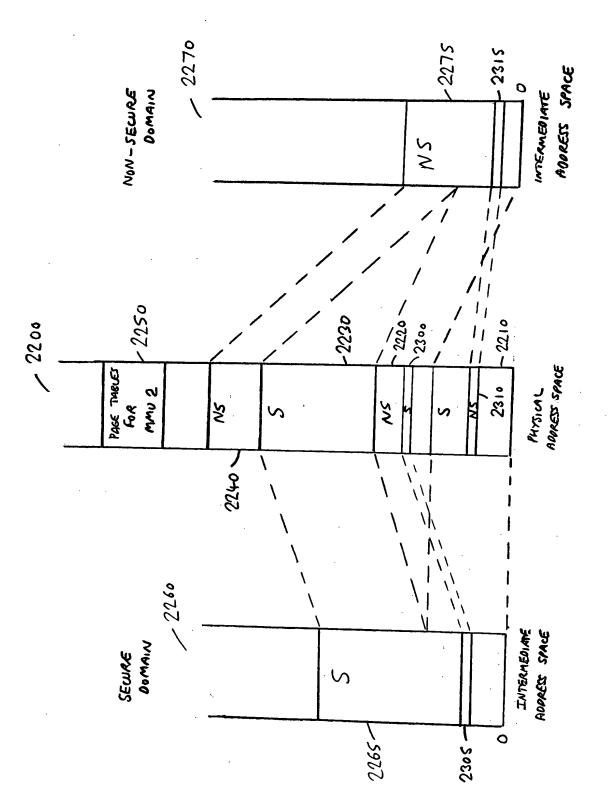
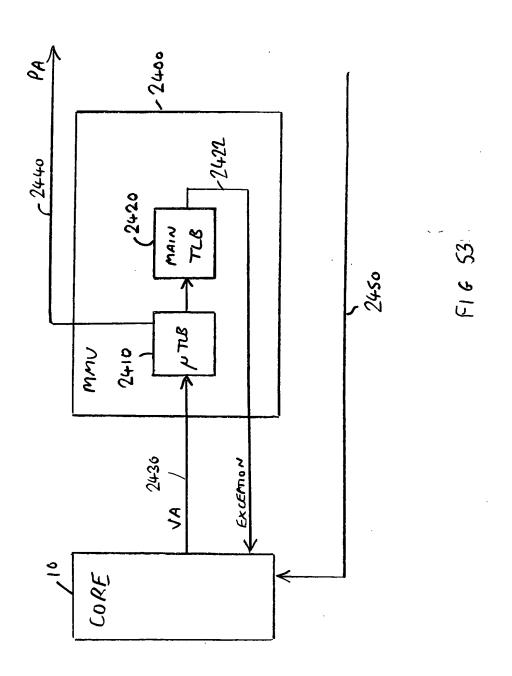
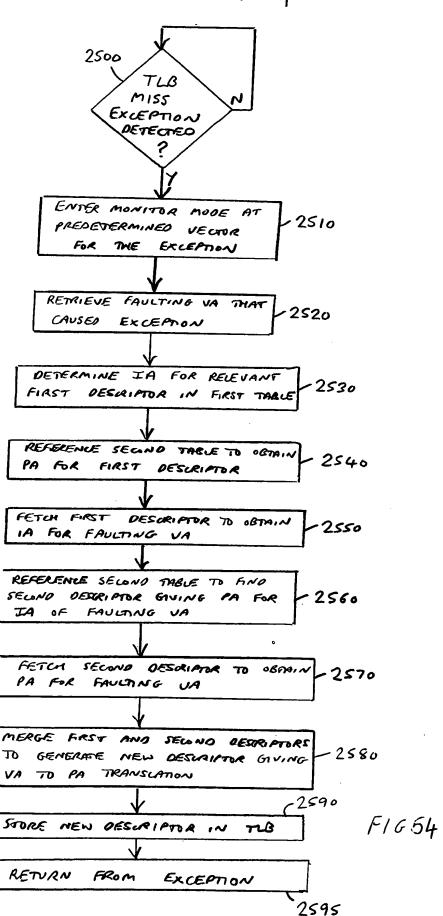


FIG 52





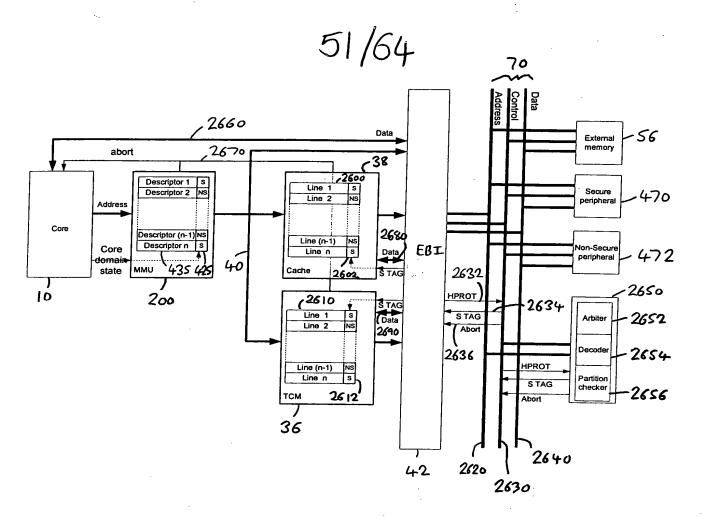


FIG 55

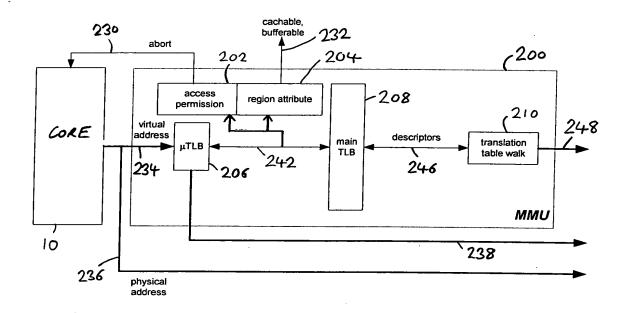


FIG 56


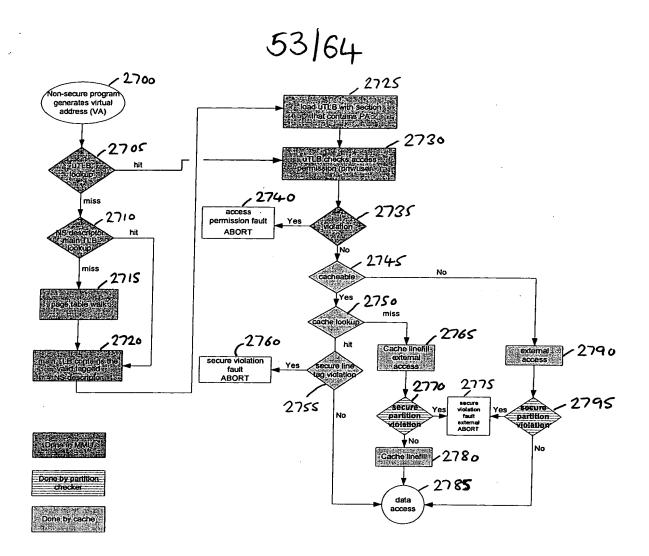


FIG 57

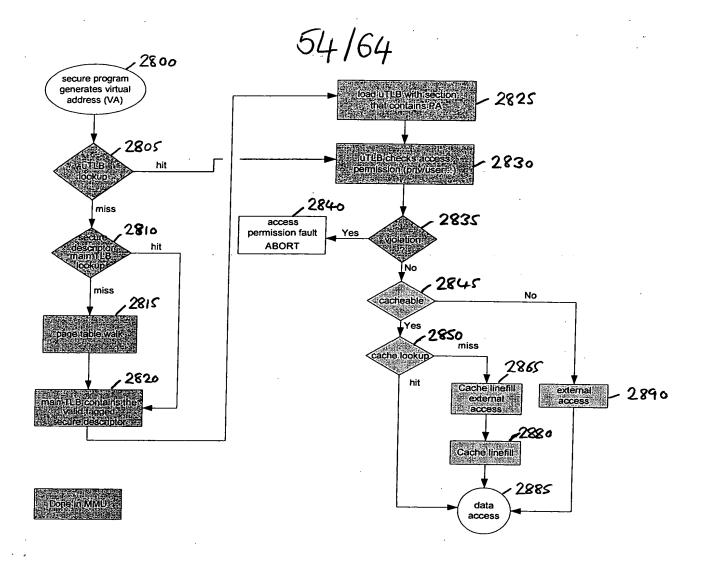

Done by cache

FIG 58

Method of entry	How to program?	How to enter?	Entry mode
Breakpoint hits	Debug TAP or software (CP14)	Program breakpoint register and/or context-ID register and comparisons succeed with Instruction Address and/or CP15 Context ID (²).	Halt/monitor
Software breakpoint instruction	Put a BKPT instruction into scan chain 4 (Instruction Transfer Register) through Debug TAP or Use BKPT instruction directly in the code.	BKPT instruction must reach execution stage.	Halt/monitor
Vector trap breakpoint	Debug TAP	Program vector trap register and address matches.	Halt/monitor
Watchpoint hits	Debug TAP or software (CP14)	Program watchpoint register and/or context-ID register and comparisons succeed with Instruction Address and/or CP15 Context ID (²).	Halt/monitor
Internal debug request	Debug TAP	Halt instruction has been scanned in.	Halt
External debug request	以上共供 Not applicable 和 。	EDBGRQ input pin is asserted.	Halt

^{(1):} In monitor mode, breakpoints and watchpoints cannot be data-dependent.

Figure 60

 $^(^2)$: The cores have support for thread-aware breakpoints and watchpoints in order to able to enable so cure debug on some particular threads.

Name	Meaning	Reset value	Access	Inserted in scan chain
Monitor mode enable bit	0: halt mode 1: monitor mode	1	R/W by programming the ICE by the JTAG (scan1) R/W by using MRC/MCR instruction (CP14)	for test yes
Secure debug enable bit	0: debug in non- secure world only. 1: debug in secure world and non- secure world	0	In functional mode or debug monitor mode: R/W by using MRC/MCR instruction (CP14) (only in secure supervisor mode) In Debug halt mode: No access – MCR/MRC instructions have any effect. (R/W by programming the ICE by the JTAG (scan1) if JSDAEN=1	no
Secure trace enable bit	0: ETM is enabled in non-secure world only. 1: ETM is enabled in secure world and non-secure world	0	In functional mode or debug monitor mode: R/W by using MRC/MCR instruction (CP14) (only in secure supervisor mode) In Debug halt mode: No access – MCR/MRC instructions have any effect. (R/W by programming the ICE by the JTAG (scan1) if JSDAEN=1	no
Secure user- mode enable bit	0: debug is not possible in secure user mode 1: debug is possible in secure user mode		In functional mode or debug monitor mode: R/W by using MRC/MCR instruction (CP14) (only in secure supervisor mode) In Debug halt mode: No access – MCR/MRC instructions have any effect. (R/W by programming the ICE by the JTAG (scan1) if JSDAEN=1	no
Secure thread-aware enable bit	0: debug is not possible for a particular thread 1: debug is possible for a particular thread	0	In functional mode or debug monitor mode: R/W by using MRC/MCR instruction (CP14) (only in secure supervisor mode) In Debug halt mode: No access – MCR/MRC instructions have any effect. (R/W by programming the ICE by the JTAG (scan1) if JSDAEN=1	no

Figure 6/

Function Table

D	CK	Q[n+1]
0		0
1		1
X	/	Q[n]

Logic Symbol

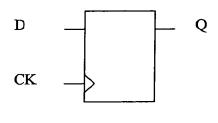


FIGURE 62

Function Table

D _.	SI	SE	CK	Q[n+1]
О	x	0		0
1	X	0		1
X	х	X		Q[n]
X	0	1		0
X	1	1		1

Logic Symbol

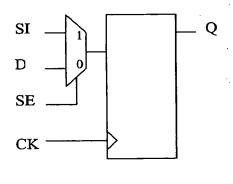


figure 63

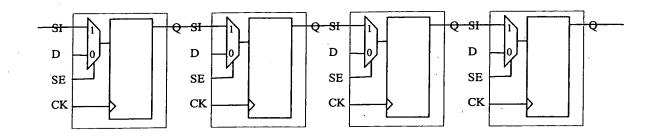


FIGURE 64

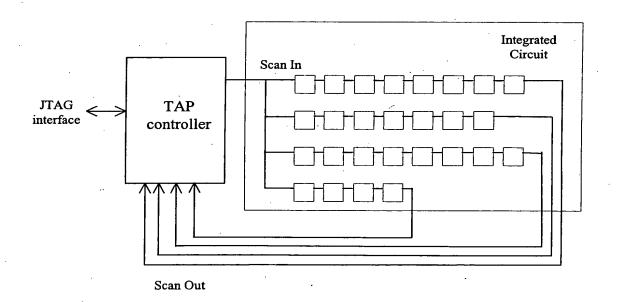


Figure 65.

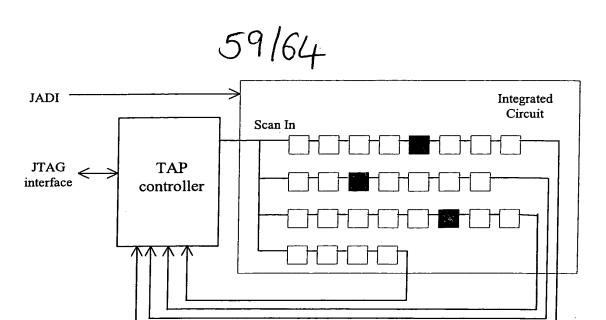


FIGURE 66 A

Scan Out

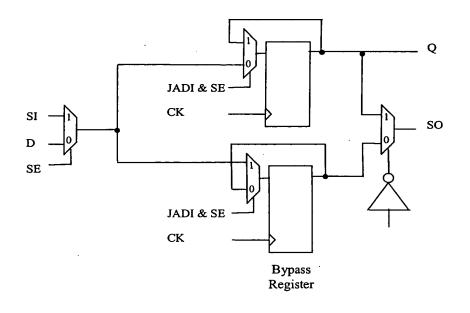


FIGURE 66 B

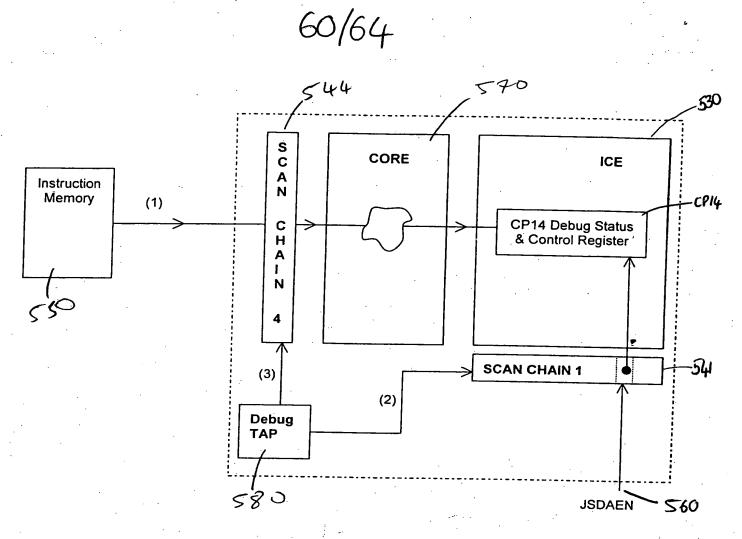


Figure 67

CP14 bits	in Debug and Status Co	ontrol register	
Secure debug enable	Secure user-mode	Secure thread-aware	meaning
bit	debug enable bit	debug enable bit	
0	Х	X	No intrusive debug in entire secure world is possible. Any debug request, breakpoints, watchpoints, and other mechanism to enter debug state are ignored in entire secure world.
1	0	X	Debug in entire secure world is possible
1	1	0	Debug in secure user-mode only. Any debug request, breakpoints, watchpoints, and other mechanism to enter debug state are taken into account in user mode only. (Breakpoints and watchpoints linked or not to a thread
		· · · · · · · · · · · · · · · · · · ·	ID are taken into account). Access in debug is restricted to what secure user can have access to.
1	1	1	Debug is possible only in some particular threads. In that case only thread-aware breakpoints and watchpoints linked to a thread ID are taken into account to enter debug state. Each thread can moreover debug its own code, and only its own code.

Figure 69A

CP14 bits in Debug and Status Control register		ontrol register		
Secure trace enable bit	Secure user-mode debug enable bit	Secure thread-aware debug enable bit	meaning	
0	Х	X	No observable debug in entire secure world is possible. Trace module (ETM) must not trace internal core activity.	
1	0	X	Trace in entire secure world is possible	
1		Ö	Trace is possible when the core is in secure user-mode only.	
1		1	Trace is possible only when the core is executing some particular threads in secure user mode. Particular hardware must be dedicated for this, or re-use breakpoint register pair: Context ID match must enable trace instead of entering debug state.	

Figure 69B

Program	Debuy
Α	1 ラシー
ß	
Α	1→ 1→ 1→ 1-→
В	

Figure 70

Method of entry	Entry when in non-secure world	entry when in secure world
Breakpoint hits	Non-secure prefetch abort handler	secure prefetch abort handler
Software breakpoint instruction	Non-secure prefetch abort handler	
Vector trap breakpoint	exceptions, prefetch abort.	secure prefetch abort exceptions (1). For other exceptions, secure prefetch abort.
Watchpoint hits		secure data abort handler
Internal debug request		debug state in halt mode
External debug request	Debug state in halt mode	debug state in halt mode

- (1) see information on vector trap register, :
- (2) Note that when external or internal debug request is asserted, the core enters halt mode and not monitor mode.

Figure 71A

Method of entry	Entry in non-secure world	entry in secure world
Breakpoint hits	Non-secure prefetch abort handler	breakpoint/ignored
Software breakpoint instruction	Non-secure prefetch abort handler	instruction ignored (v)
Vector trap breakpoint	Disabled for non-secure data abort and non-secure prefetch abort interruptions. For others interruption non-secure prefetch abort.	breakpoint/ignored
Watchpoint hits	Non-secure data abort handler	watchpoint ignored
Internal debug request	Debug state in halt mode	request ignored :
External debug request	Debug state in halt mode	request ignored 🐪 🐪 🕌
Debug re-entry from system speed access	not applicable	not applicable

(1) As substitution of BKPT instruction in secure world from non-secure world is not possible, non-secure abort must handle the violation.

Figure 718